


Smoke and Dye Testing Summary

High Level Sewershed

Run Summary

Test ID	Test Type	Date Inspected	Company / Super.	Blower MH	Ground Condition	Notification Made?	Total Length
S1028-281	Smoke	9/9/2009	ADS/TM	S11KK1002MH	Dry	Yes	944.30

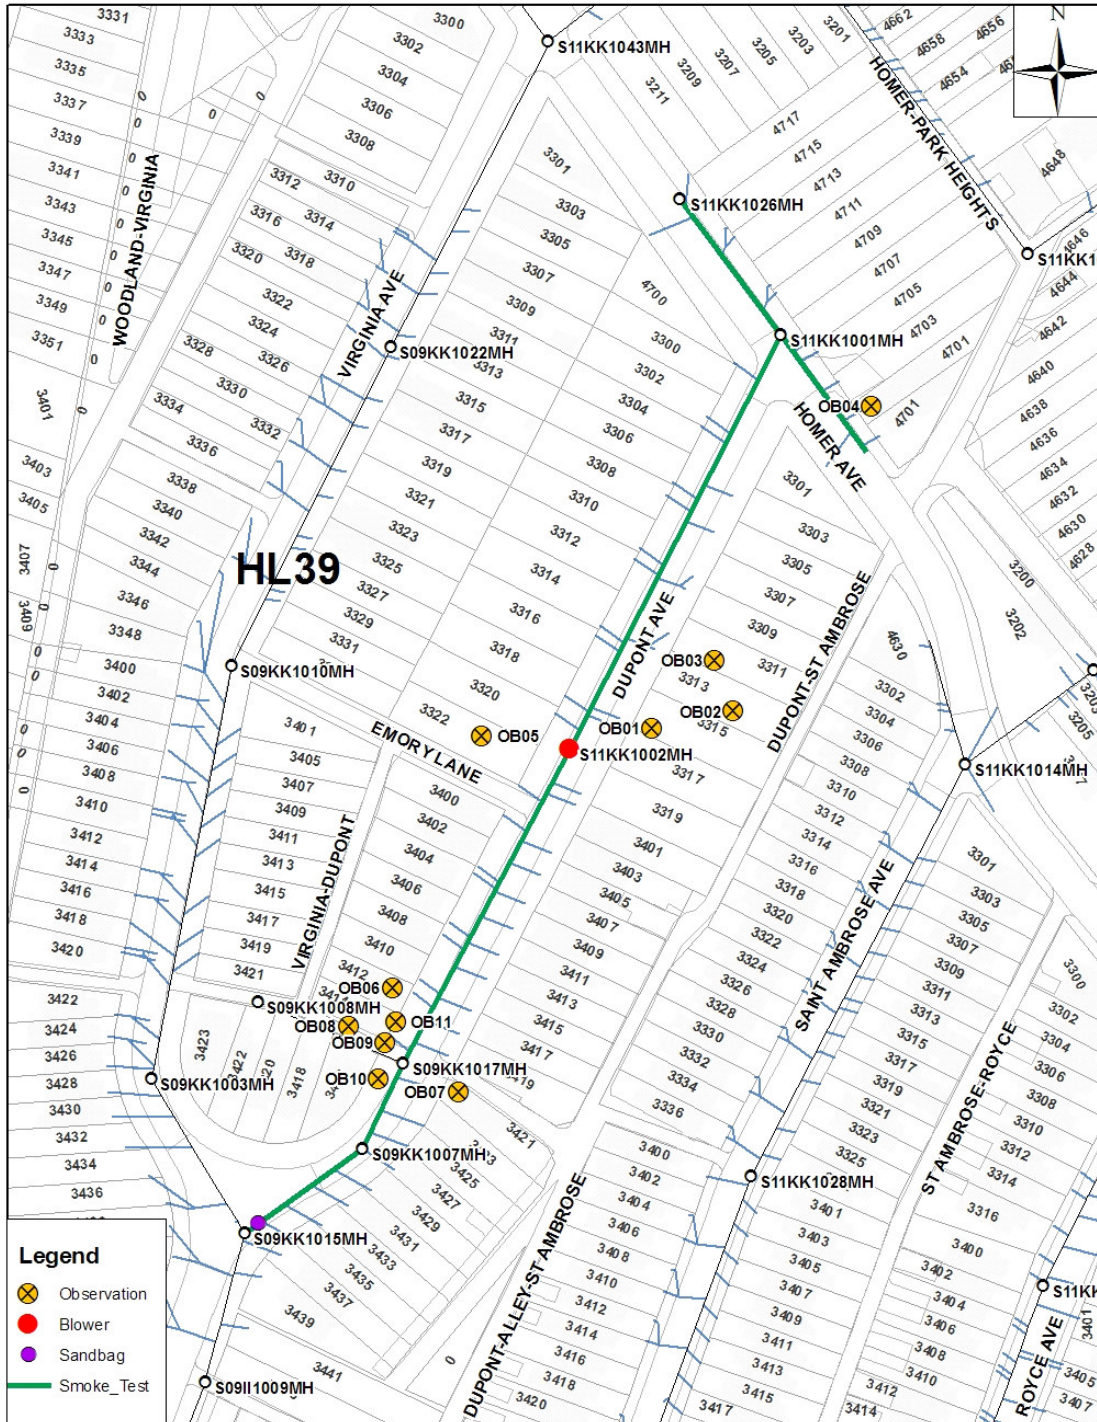

Smoke and Dye Testing Summary

High Level Sewershed

Run Summary

Test ID	Test Type	Date Inspected	Company / Super.	Blower MH	Ground Condition	Notification Made?	Total Length
S1028-281	Smoke	9/9/2009	ADS/TM	S11KK1002MH	Dry	Yes	944.30

Isolated Pipes

Pipe ID	Upstream MH	Downstream MH	Length (ft)	Diameter (In)
S11KK1026G1	S11KK1026MH	S11KK1001MH	115.754	8
S11KK1036G1	S11KK1036DE	S11KK1001MH	99.9478	8
S11KK1001G1	S11KK1001MH	S11KK1002MH	319.729	8
S11KK1002G1	S11KK1002MH	S09KK1017MH	244.394	8
S09KK1007G1	S09KK1007MH	S09KK1015MH	99.6617	8
S09KK1017G1	S09KK1017MH	S09KK1007MH	64.8103	8

Observations & Photos

Obs_ID S1028-281-OB01

Address 3315 Dupont Ave

Status Private

Source Cleanout

Location Field / woods

Nearest MH S11KK1002MH

Comments Smoke from cleanout in field. 3315 Dupont Ave.



Picture \S1028-281-OB01-P01.jpg

Comments Front of lot, 3315 Dupont Ave.

Obs_ID S1028-281-OB02

Address 3313 Dupont Ave

Status Private

Source Service Lateral

Location Field / woods

Nearest MH S11KK1002MH

Comments Smoke from service lateral in field. 3313 Dupont Ave.



Picture \S1028-281-OB02-P01.jpg

Comments Front of lot, 3313 Dupont Ave.

Smoke and Dye Testing Summary

High Level Sewershed

Run Summary

Test ID	Test Type	Date Inspected	Company / Super.	Blower MH	Ground Condition	Notification Made?	Total Length
S1028-281	Smoke	9/9/2009	ADS/TM	S11KK1002MH	Dry	Yes	944.30

Obs_ID S1028-281-OB03

Address 3311 Dupont Ave

Status Private

Source Cleanout

Location Field / woods

Nearest MH S11KK1002MH

Comments Smoke from cleanout in field. 3311 Dupont Ave.



Picture \S1028-281-OB03-P01.jpg

Comments Front of lot, 3311 Dupont Ave.

Obs_ID S1028-281-OB05

Address 3322 Dupont Ave

Status Private

Source Service Lateral

Location Field / woods

Nearest MH S11KK1002MH

Comments Smoke from service lateral in field. 3322 Dupont Ave.



Picture \S1028-281-OB05-P01.jpg

Comments South side of lot, 3322 Dupont Ave.

Obs_ID S1028-281-OB04

Address 4701 Homer Ave

Status Private

Source Cleanout

Location Yard - front

Nearest MH S11KK1001MH

Comments Smoke from cleanout in front yard. 4701 Homer Ave.



Picture \S1028-281-OB04-P01.jpg

Comments Front of house, 4701 Homer Ave.

Obs_ID S1028-281-OB06

Address 3412 Dupont Ave

Status Private

Source Cleanout

Location Yard - front

Nearest MH S09KK1017MH

Comments Smoke from cleanout in front yard. 3412 Dupont Ave.



Picture \S1028-281-OB06-P01.jpg

Comments Front of house, 3412 Dupont Ave.

Smoke and Dye Testing Summary

High Level Sewershed

Run Summary

Test ID	Test Type	Date Inspected	Company / Super.	Blower MH	Ground Condition	Notification Made?	Total Length
S1028-281	Smoke	9/9/2009	ADS/TM	S11KK1002MH	Dry	Yes	944.30

Obs_ID S1028-281-OB07

Address 3421 Dupont Ave

Status Private

Source Cleanout

Location Yard - front

Nearest MH S09KK1017MH

Comments Smoke from cleanout in front yard. 3421 Dupont Ave.



Picture \S1028-281-OB07-P01.jpg

Comments Front of house, 3421 Dupont Ave.

Obs_ID S1028-281-OB09

Address 3416 Dupont Ave

Status Public

Source Catch Basin

Location Alley

Nearest MH S09KK1017MH

Comments Smoke from catch basin in alley behind 3416 Dupont Ave.



Picture \S1028-281-OB09-P01.jpg

Comments Alley behind 3416 Dupont Ave. looking east

Obs_ID S1028-281-OB08

Address 3416 Dupont Ave

Status Public

Source Other

Location Alley

Nearest MH S09KK1017MH

Comments Smoke from storm drain under alley behind 3416 Dupont Ave.



Picture \S1028-281-OB08-P01.jpg

Comments Back of house, 3416 Dupont Ave.

Obs_ID S1028-281-OB10

Address 3416 Dupont Ave

Status Public

Source Catch Basin

Location Curb

Nearest MH S09KK1017MH

Comments Smoke from catch basin along curb at side of 3416 Dupont Ave.



Picture \S1028-281-OB10-P01.jpg

Comments Side yard, 3416 Dupont Ave.

Smoke and Dye Testing Summary

High Level Sewershed

Run Summary

Test ID	Test Type	Date Inspected	Company / Super.	Blower MH	Ground Condition	Notification Made?	Total Length
S1028-281	Smoke	9/9/2009	ADS/TM	S11KK1002MH	Dry	Yes	944.30

Obs_ID S1028-281-OB11

Address 3414 Dupont Ave

Status Public

Source Catch Basin

Location Curb

Nearest MH S09KK1017MH

Comments Smoke from catch basin along curb in front of 3414 Dupont Ave.



Picture \S1028-281-OB11-P01.jpg

Comments Front of house, 3414 Dupont Ave.